

All tests in this report are executed according to the ISO 9001
 certified Quality management system of the BBRI

Test Centre
 Offices
 Head Office

B-1342 Limelette, avenue P. Holoffe 21
 B-1932 Sint-Stevens-Woluwe, Lozenberg 7
 B-1000 Bruxelles, rue du Lombard 42

Tel.: +32 (0)2 655 77 11
 Tel.: +32 (0)2 716 42 11
 Tel.: +32 (0)2 502 66 90

TEST REPORT

Laboratory Air Quality and Ventilation	O/References	DE 633X198 VE 293/3/EN Page 1/5
---	---------------------	---------------------------------------

Requested by	Climatech François Gohy Avenue Gevaert 236/238 B-1332 Genva		
Date of the order	31-03-2014	Samples registration	N-2014-10-012
		Date of reception of samples	07-02-2014
Date of issue of the report	02-06-2014		
Test carried out	Measurement of the casing leakage of a damper or valve		
References	NBN EN 1751:2014 Ventilation for buildings - Air terminal devices - Aerodynamic testing of dampers and valves		

*This test report contains 5 pages and may only be reproduced in its entirety.
 Each page of the report has been stamped (in red) by the laboratory and initialed by the head of laboratory.
 The results and findings are only valid for the tested samples.*

- ☐ No sample
☐ Sample(s) subjected to destructive test
☒ Sample(s) to be removed from our laboratories 30 calendar days after sending of the report,
 save in the case of a further written request.



In charge of the tests
 Philippe Voordecker

Head of laboratory
 Christophe Delmotte, Ir.

Test procedure

The determination of the casing leakage of a damper or valve is carried out according to NBN EN 1751:2014 «Ventilation for buildings - Air terminal devices - Aerodynamic testing of dampers and valves».


The test installation comprises the following:

- an adjustable air supply incorporating an air flow rate measuring device;
- a pressure measuring device;
- an airtight test duct which supports the damper or valve subject to the test;
- a blanking plate for the damper or valve.

The test is carried out by subjecting the casing of the damper or valve to a pressure of 2000 Pa. The pressure is then lowered in stages. The air flow rate is recorded at each of the pressure stages.

If temperature and barometric pressure are different from the standard conditions (20 °C and 101325 Pa), the measured airflows are corrected accordingly.


Normalized values are determined through a linear regression.

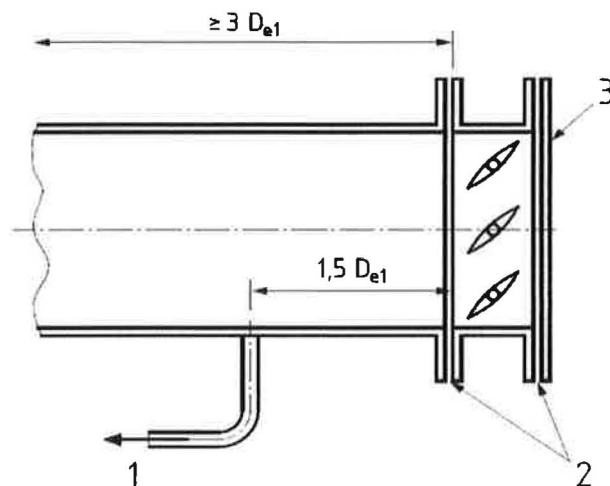

Key

- 1 to manometer
- 2 sealed joints
- 3 blanking plate

Principle of test installation according to NBN EN 1751:2014

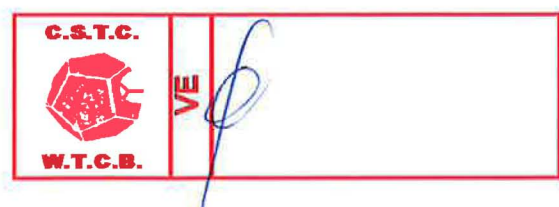

Description of the sample

Iris damper with a nominal diameter of 200 mm (IRIS-200 code 720200 Climatech)

Date of test:

12-03-2014

Measuring devices:

Platon GTLK

Calibration:

22-05-1989

Organization:

Platon

Airflow TA460-P

18-06-2013

TSI Airflow

Testo 720 n°5

13-11-2013

CSTC-WTCB

Airflow TA460-P

18-06-2013

TSI Airflow

Measurement conditions:

Air temperature 20,6 °C

Barometric pressure 101420 Pa

Reference casing area:

Perimeter of the damper 0,628 m

Reference area 0,628 m²

Measured values

Static pressure p_s (Pa)	Leakage air flow $q_{VL\text{ meas}}$ (l/s)
200	0,009
400	0,014
600	0,018
800	0,023
1000	0,028
1200	0,033
1400	0,035
1600	0,040
1800	0,043
2000	0,047

Corrected values

Case leakage air flow q_{VLCA} (l/s.m²)
0,015
0,023
0,029
0,037
0,045
0,052
0,056
0,064
0,068
0,074


Normalized values

Classification of case leakage: Class C

Static pressure (Pa)	Leakage air flow (l/s)
250	0,010
500	0,017
1000	0,028
1500	0,037
2000	0,046

Flow rate / pressure characteristic

$$q = C \Delta p^n \quad (\text{l/s})$$

$$C = 0,000195 \quad (\text{l/s. Pa}^n)$$

$$n = 0,7186 \quad (-)$$

